


Control and Display Elements

State LED	Meaning
Green	Measuring object within the measuring range
Yellow	Measuring object in the mid of the measuring range
Red	No distance value available, e.g. target outside the measuring range, too low reflection
Yellow flashing, 1 Hz	Bootloader
Yellow flashing, 8 Hz	Installation active
State LED lights up (green, yellow or red) and briefly flashes yellow at intervals of approx. 1 sec.	Ethernet setup mode
Off	Laser switched off
LED RUN/SF/MS	Meaning
	depending on PROFINET operation
LED ERR/BF/NS	Meaning
	depending on PROFINET operation
Select button	Meaning
-	Resetting to factory setting

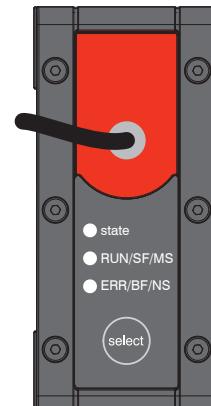

Quick Guide

Structure of the Components

Mount the sensor and connect the components to one another.

Initial Operation

Connect the sensor to a power supply.

Operation via Web Interface

The sensors start with the last stored operating mode. Standard is Industrial Ethernet (IE). A web server is implemented in the sensor; the web interface displays, among other things, the current settings of the sensor. Operation is only possible while there is an Ethernet connection to the sensor.

PROFINET

i An ILD1900-IE with PROFINET has no IP address by default. The static IP address and the device name are assigned via DCP (Discovery and Configuration Protocol). The IP address and the device name can be assigned, e.g., via the TIA Portal software.

Assign an IP address to the sensor.

You can find an example of this in the appendix of the operating instructions.


Turning on the Laser

The measuring laser on the sensor is switched on via a software command or a switching input. This allows to switch off the sensor for maintenance purposes or similar. Response time: after the laser is switched on, the sensor needs depending on the measuring rate five cycles to send correct measured data.

Laser on/off via hardware, Supply

A switching transistor with open collector (for example in an optocoupler), a relay contact or a digital TTL or HTL signal are suitable for switching.

Activation using the PC1900-IE-x/OE-RJ45 cable is possible.

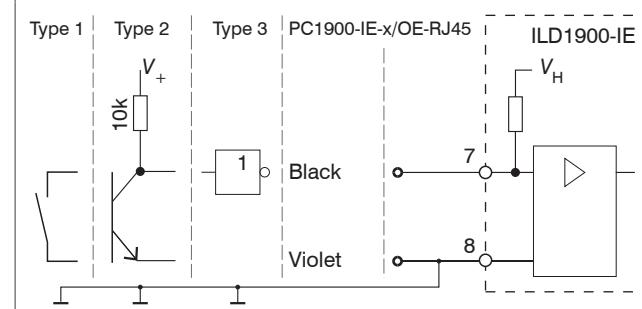

The inputs are not electrically separated.

24 V logic (HTL): Low level ≤ 3 V;
High level ≥ 8 V (max 30 V)

internal pull-up resistor, an open input is detected as High.
Max. switching frequency 10 Hz

The ground of the logic circuit must be galvanically connected to "Laser on/off -".

No external resistance is required for current limitation. For permanent "Laser on", connect the black and violet wires.

Proper Environment

- Protection class: IP67 (applies only when sensor cable is plugged in)

Lenses are excluded from the protection class. Contamination of the lenses causes impairment or failure of the function.


- Temperature range
 - Operation: 0 ... +50 °C
 - Storage: -20 ... +70 °C
- Humidity: 5 ... 95 % (non-condensing)
- Ambient pressure: Atmospheric pressure

Access via Web Interface

Start your web browser.

Type the IP address of the sensor into the address bar.

Interactive web pages you can use to configure the sensor are now displayed in the web browser. The web interface does not guarantee real-time measurements. The currently running measurement can be controlled using the function buttons in the **Chart type** section.

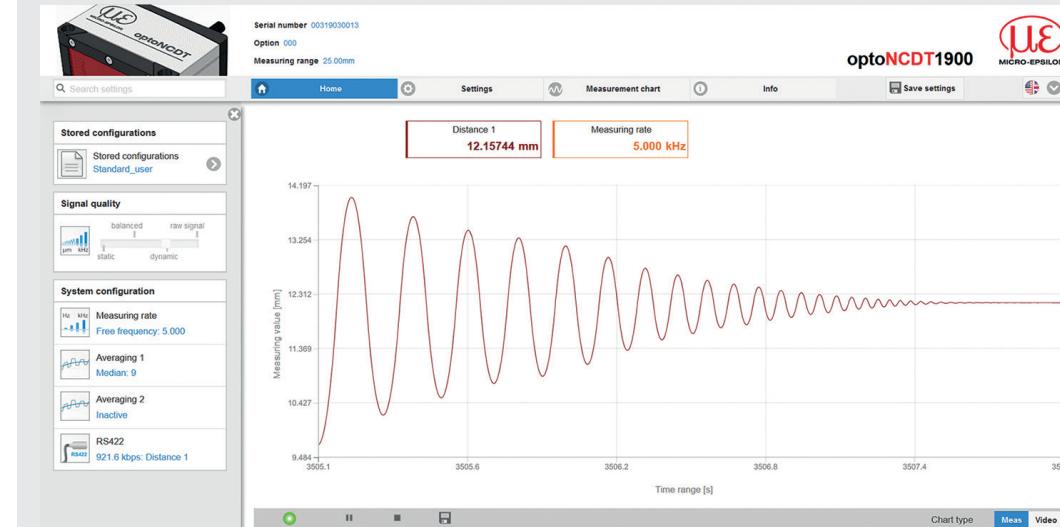

In the top navigation bar, other functions (settings, measurement chart etc.) are available. The appearance of the websites can change dependent of the functions. Each page contains dynamic parameter descriptions and tips on completing the web page.

After parameterization, store all settings permanently in a parameter set so that they are available again the next time the sensor is switched on. To do this, use the **Save settings** button.

Positioning the Target

Position the target as centrally as possible within the measuring range.

The **state** LED on the sensor indicates the position of the target to the sensor.

LED	Color	Meaning
state	Off	Laser beam is switched off.
	Green	Measuring object within the measuring range
	Yellow	Target is in the mid of measuring range.
	Red	No distance value available, e.g. target outside the measuring range, too low reflection

Saving the Settings, Continuing Industrial Ethernet Operation

Go to **Settings > System settings > Load & Save** or click the **Save settings** button.

The sensor now also saves the settings for use in Industrial Ethernet operation.

Continue working in your PLC environment.

You can find more information about the sensor in the operating instructions.
They are available online at:

<https://www.micro-epsilon.com/distance-sensors/laser-sensors/optoncdt-1900/>
or with the QR code at right:

