



# More Precision

**capaNCDT** // Capacitive sensors for displacement, distance & gap



# Sensors for challenging environments

## capaNCDT CSH/SE

Cylindrical sensors for vacuum, cleanroom and strong magnetic fields



Model		CSH-0,25/SE/CAM-1,4	CSH-0,5/SE/CAM-1,4	CSH-1/SE/CAM-1,4	CSH-1,2/SE/CAM-1,4	CSH-2/SE/CAM-1,4
Measuring range	Reduced	0.125 mm	0.25 mm	0.5 mm	0.6 mm	1 mm
	Nominal	0.25 mm	0.5 mm	1 mm	1.2 mm	2 mm
	Extended	0.5 mm	1 mm	2 mm	2.4 mm	4 mm
Resolution <sup>[1]</sup>	Static	0.075 nm	0.15 nm	0.3 nm	0.36 nm	0.6 nm
	Dynamic	5 nm	10 nm	20 nm	24 nm	40 nm
Linearity <sup>[2]</sup>		< ±0.25 μm	< ±0.35 μm	< ±0.6 μm	< ±1.2 μm	< ±0.6 μm
Replaceability <sup>[3]</sup>		< ±0.4 % FSO	< ±0.3 % FSO	< ±0.2 % FSO	< ±0.2 % FSO	< ±0.2 % FSO
Temperature stability <sup>[4]</sup>		-0.04 μm/K	-0.05 μm/K	-0.06 μm/K	-0.05 μm/K	-0.04 μm/K
Recommended target size (flat) <sup>[5]</sup>		Ø 5 mm	Ø 7 mm	Ø 11 mm	Ø 11 mm	Ø 17 mm
Active measuring area		Ø 2.9 mm	Ø 4.1 mm	Ø 5.7 mm	Ø 6.3 mm	Ø 8.1 mm
Connection	integrated cable with connector (type B); standard length 1.4 m					
Mounting	Circumferential clamping					
Temperature range	Storage	-269 ... 200 °C				
	Operation	-269 ... 200 °C				
Shock (DIN EN 60068-2-27)	30g / 5 ms in XY axis, 1000 shocks each					
Vibration (DIN EN 60068-2-6)	20 g / 10 ... 2000 Hz in XY axis, 10 cycles each					
Protection class (DIN EN 60529)	IP40					
Material	3.7035 (Grade 2 titanium)					
Weight		approx. 30 g (incl. cable)	approx. 30 g (incl. cable)	approx. 33 g (incl. cable)	approx. 33 g (incl. cable)	approx. 38 g (incl. cable)
Recommended mounting position <sup>[6]</sup>	3 mm					
Compatibility	Compatible with all capacitive controllers from Micro-Epsilon Sensors can be replaced as required without recalibration (see replacement accuracy)					

<sup>[1]</sup> RMS noise referred to the end of the measuring range and to the nominal measuring range using the standard cable CCm (1.4 m); valid for operation with the DT6530: static 2 Hz, dynamic 8.5 kHz

<sup>[2]</sup> Typical linearity to be added to the controller linearity; valid for standard cable adjustment CCm (1.4 m)

<sup>[3]</sup> FSO = Full Scale Output | The value corresponds to the slope error that occurs when a sensor is replaced without recalibration

<sup>[4]</sup> In the recommended mounting position

<sup>[5]</sup> In relation to the nominal measuring range

<sup>[6]</sup> From the sensor front face (measuring surface), opposite to the measuring direction

### Mounting of cylindrical CSH/SE sensors

CSH/SE cylindrical sensors can be installed either protruding (with the sensor extending beyond the mounting bracket) or flush with the mounting bracket. The sensor is mounted either by point clamping using a plastic set screw or by circumferential clamping using a collet. When using circumferential clamps, please note that the surrounding material may cause heat buildup.

### Recommended mounting of CSH/SE sensors




With set screw

With circumferential clamping

# Sensors for challenging environments

## capaNCDT CSH/FL/SE

Flat sensors for vacuum, cleanroom and strong magnetic fields

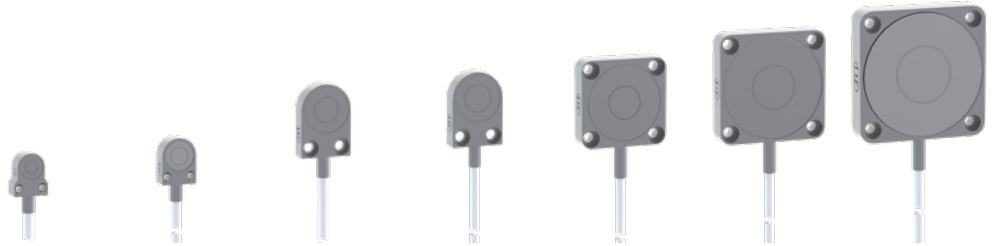

Model		CSH-0,25/FL/SE/CRm-1,4	CSH-0,5/FL/SE/CRm-1,4	CSH-1/FL/SE/CRm-1,4	CSH-1,2/FL/SE/CRm-1,4	CSH-2/FL/SE/CRm-1,4	CSH-3/FL/SE/CRm-1,4	CSH-5/FL/SE/CRm-1,4
Measuring range	Reduced	0.125 mm	0.25 mm	0.5 mm	0.6 mm	1 mm	1.5 mm	2.5 mm
	Nominal	0.25 mm	0.5 mm	1 mm	1.2 mm	2 mm	3 mm	5 mm
	Extended	0.5 mm	1 mm	2 mm	2.4 mm	4 mm	6 mm	10 mm
Resolution <sup>[1]</sup>	Static	0.075 nm	0.15 nm	0.3 nm	0.36 μm	0.6 nm	0.9 nm	1.5 nm
	Dynamic	5 nm	10 nm	20 nm	24 μm	40 nm	60 nm	100 nm
Linearity <sup>[2]</sup>		< ±0.25 μm	< ±0.35 μm	< ±0.6 μm	< ±1.2 μm	< ±0.6 μm	< ±1.5 μm	< ±15 μm
Replaceability <sup>[3]</sup>		< ±0.4 % FSO	< ±0.3 % FSO	< ±0.2 % FSO	< ±0.2 % FSO	< ±0.2 % FSO	< ±0.2 % FSO	< ±0.5 % FSO
Temperature stability	Front-side mounting	+0.025 μm/K	+0.015 μm/K	+0.035 μm/K	+0.042 μm/K	+0.08 μm/K	+0.075 μm/K	+0.1 μm/K
	Rear-side mounting	-0.011 μm/K	-0.021 μm/K	-0.001 μm/K	+0.006 μm/K	+0.035 μm/K	+0.03 μm/K	+0.055 μm/K
Recommended target size (flat) <sup>[4]</sup>		Ø 5 mm	Ø 7 mm	Ø 11 mm	Ø 11 mm	Ø 17 mm	Ø 24 mm	Ø 30 mm
Active measuring area		Ø 2.9 mm	Ø 4.1 mm	Ø 5.7 mm	Ø 6.3 mm	Ø 8.1 mm	Ø 10 mm	Ø 13 mm
Connection		integrated cable with connector (type B); standard length 1.4 m						
Mounting		2 x M2 thread		2 x through hole for M2 screw		4 x through hole for M2 screw		
Temperature range	Storage	-269 ... 200 °C						
	Operation	-269 ... 200 °C						
Shock (DIN EN 60068-2-27)		30g / 5 ms in XY axis, 1000 shocks each						
Vibration (DIN EN 60068-2-6)		20 g / 58 ... 2000 Hz in XY axis, 10 cycles each						
Protection class (DIN EN 60529)		IP40						
Material		3.7035 (Grade 2 titanium)						
Weight		approx. 28 g (incl. cable)	approx. 28 g (incl. cable)	approx. 30 g (incl. cable)	approx. 30 g (incl. cable)	approx. 37 g (incl. cable)	approx. 37 g (incl. cable)	approx. 37 g (incl. cable)
Compatibility		Compatible with all capacitive controllers from Micro-Epsilon Sensors can be replaced as required without recalibration (see replacement accuracy)						

<sup>[1]</sup> RMS noise referred to the end of the measuring range and to the nominal measuring range using the standard cable CCm (1.4 m); valid for operation with the DT6530: static 2 Hz, dynamic 8.5 kHz

<sup>[2]</sup> Typical linearity to be added to the controller linearity; valid for standard cable adjustment CCm (1.4 m)

<sup>[3]</sup> FSO = Full Scale Output | The value corresponds to the slope error that occurs when a sensor is replaced without recalibration

<sup>[4]</sup> In relation to the nominal measuring range

### Mounting of CSH/FL/SE flat sensors

The flat sensors are mounted using a threaded hole for M2 screws (for the CSH-0.25/FL/SE and CSH-0.5/FL/SE sensors) or a through hole for M2 screws. The sensors can be screwed on from above or below.

### Recommended mounting of CSH/FL/SE sensors



Top screw connection on the sensor base




Screw mounting from below on the top of the sensor (CSH-0.25FL – CSH-1.2/FL/SE)

# Dimensions


## capaNCDT CSE/HT / capaNCDT CSH/SE

### CSE/HT


CSE-1/HT/CA-1,0

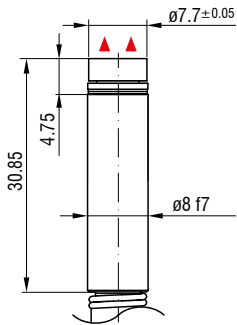


CSE-2/HT/CA-1,0

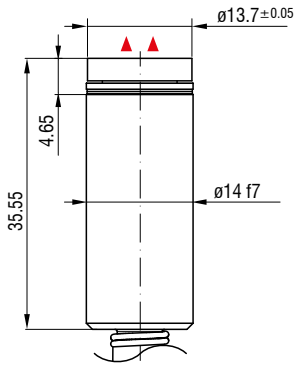

CSE-5/HT/CA-1.0

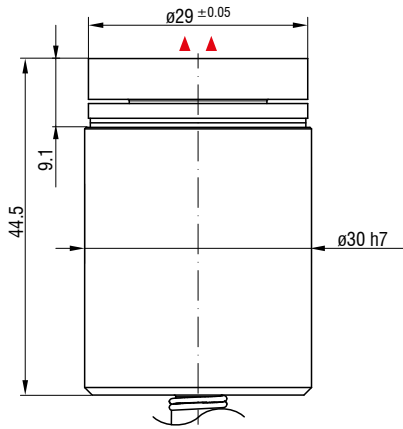


CSE-10/HT/CA-1,0

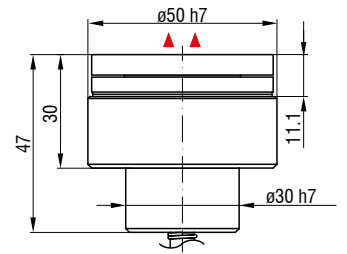


### CSH/SE


CSH-0,25/SE/CAm-1,4

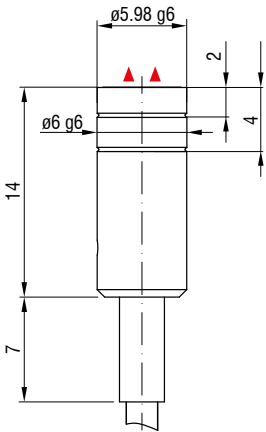


CSH-0,5/SE/CAm-1,4

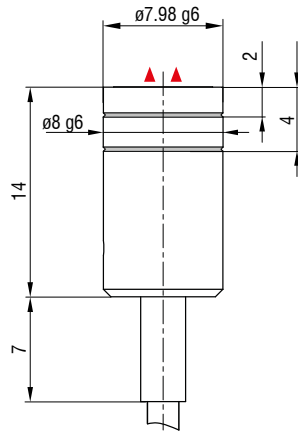


CSH-1/SE/CAm-1,4

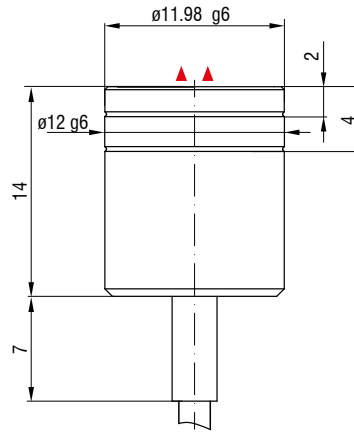

CSH-1,2/SE/CAm-1,4

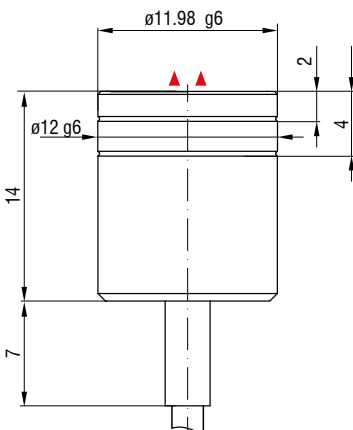


CSH-2/SE/CAm-1,4

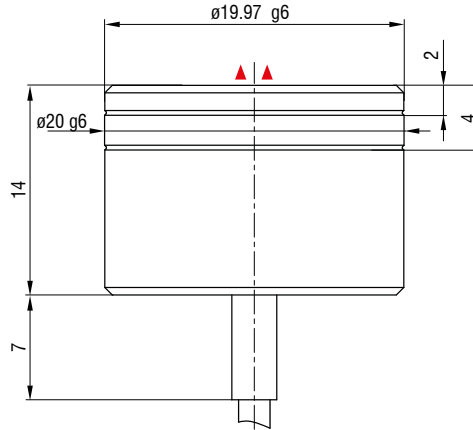


CSH/FL/SE


CSH-0,25/FL/SE/  
 CRm-1,4

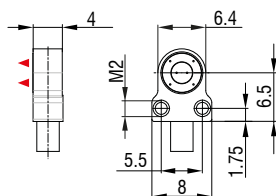


CSH-0,5/FL/SE/  
 CRm-1,4

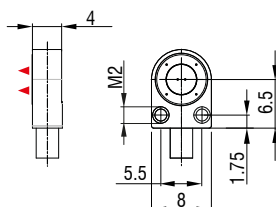


CSH-1/FL/SE/  
 CRm-1,4

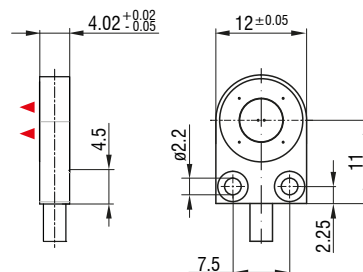


CSH-1,2/FL/SE/  
 CRm-1,4

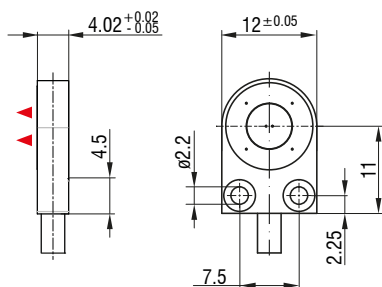


CSH-2/FL/SE/  
 CRm-1,4

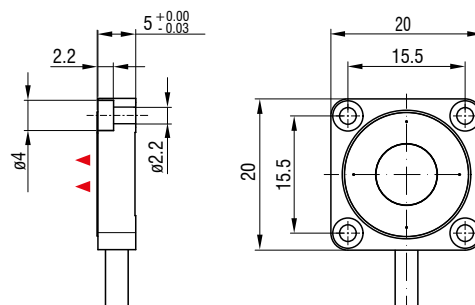

CSH-3/FL/SE/  
 CRm-1,4

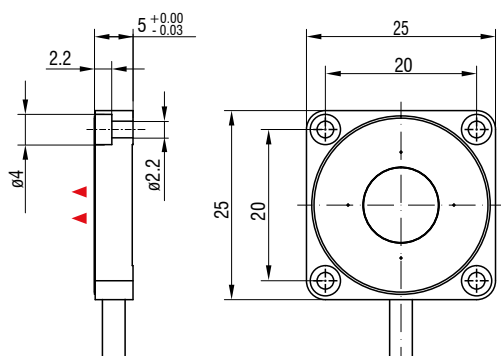

CSH-5/FL/SE/  
 CRm-1,4

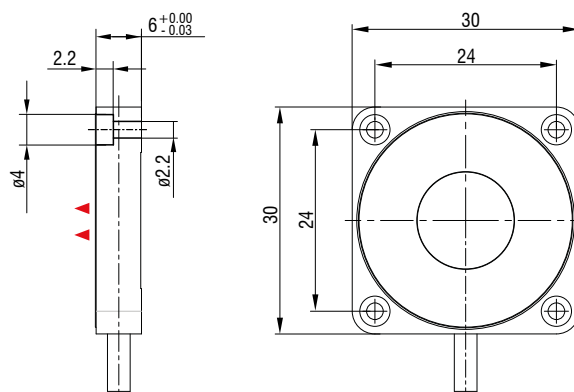

# Dimensions of the connectors

## capaNCDT


All sensors can be combined with all controllers and sensor cables. To connect the sensors, you simply need to use the correct type of connector. Micro-Epsilon will select the right sensor cable with the appropriate connectors for you during the quotation and ordering process. The following dimensional drawings are intended to help you make an initial selection.

- The sensor connection varies depending on the sensor type. Depending on the model, the cable is either permanently integrated into the sensor or connected via an external sensor cable. Depending on the design and size, different connector types and sizes are used, which must be taken into account when selecting sensor cables. For more information on this, please refer to the technical specifications for the sensors under "Connection".
- The sensor is always connected to the controller using a type B connector.

You can find an overview of all connection and combination options on pages 52 - 53.


### Type B connector

- On each sensor with an integrated cable or on one end of a sensor cable (except CSE/HT)
- For plug-in sensors with measuring ranges of  $\geq 1$  mm

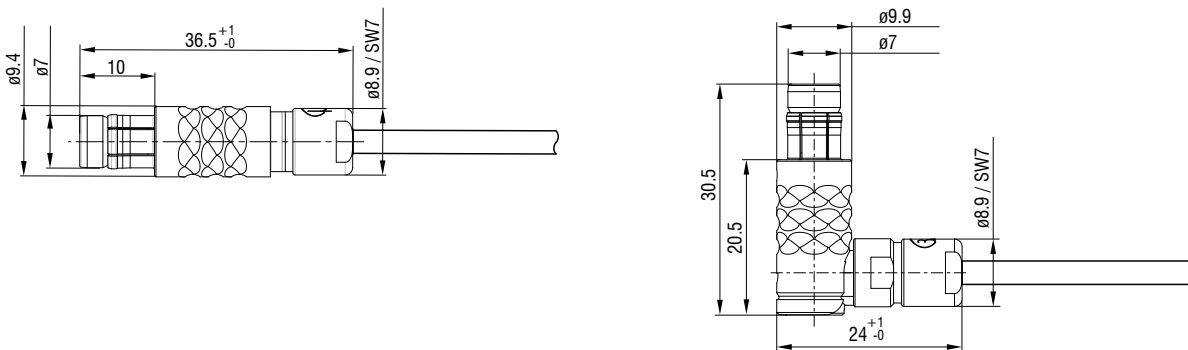


### Cable with connector type C

- On one end of a sensor cable
- For all plug-in sensors with measuring ranges of  $\leq 1$  mm

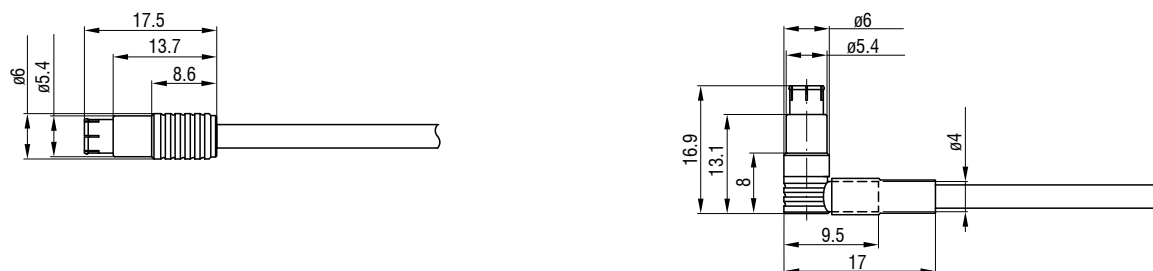

### Cable with connector type E

- On one end of a sensor cable
- For all CSF flat sensors

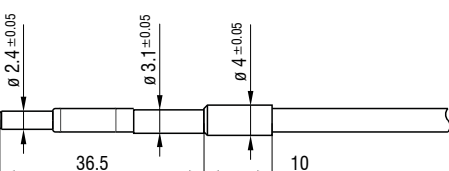

# Connections and combinations

## capaNCDT

### Controller



DT6100



DT6200




DT6500

### Sensor cable




#### Type: CCg

Robust triaxial cable for industrial applications  
 Cable diameter: 3.1 mm ( $\pm 0.1$  mm)  
 Minimum bending radius: static approx. 10 mm /  
 dynamic approx. 30 mm  
 Temperature resistance: -20 ... +85 °C (permanent) /  
 -20 ... +100 °C (limited to 10,000 h)  
 Standard length: 2 m (optional lengths see p. 41)

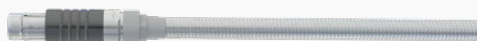

#### Type CCg/PT

Crush-resistant triaxial cable with protective metal tubing  
 Cable diameter: 6 mm ( $\pm 0.15$  mm)  
 Minimum bending radius: static approx. 20 mm /  
 dynamic approx. 30 mm  
 Temperature resistance: -20 °C ... +85 °C (permanent) /  
 -20 ... +100 °C (limited to 10,000 h)  
 Standard length: 2 m (optional lengths see p. 41)

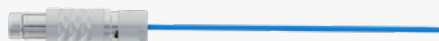

#### Type CCm

Low-outgassing triaxial cable for UHV and cleanroom  
 Cable diameter: 2.1 mm ( $\pm 0.1$  mm)  
 Minimum bending radius: static approx. 7 mm /  
 dynamic approx. 25 mm  
 Temperature resistance: up to -100 ... 200 °C  
 Standard length: 1.4 m (optional lengths see p. 41)



#### Type CCo

Low-outgassing triaxial cable for high temperatures  
 Cable diameter: 3.1 mm ( $\pm 0.1$  mm)  
 Minimum bending radius: static approx. 10 mm /  
 dynamic approx. 30 mm  
 Temperature resistance: -20 ... +200 °C  
 Standard length: 2 m (optional lengths see p. 41)

Sensors with integrated cable use the cable types CCM and CCg

#### Type CCM

Low-outgassing triaxial cable for UHV and cleanroom  
 Cable diameter: 2.1 mm ( $\pm 0.1$  mm)  
 Minimum bending radius: static approx. 15 mm /  
 dynamic approx. 30 mm  
 Temperature resistance: up to 200 °C  
 Standard length: 1.4 m (optional lengths see p. 41)

#### Type CCg

Robust triaxial cable for industrial applications  
 Cable diameter: 3.1 mm ( $\pm 0.1$  mm)  
 Minimum bending radius: static approx. 10 mm /  
 dynamic approx. 30 mm  
 Temperature resistance: -20 °C ... +85 °C (permanent) /  
 -20 ... +100 °C (limited to 10,000 h)  
 Standard length: 2 m (optional lengths see p. 41)

**Plug connector**



Type B connector



Type B / 90 connector



Type B / IP connector



Type C connector



Type C / 90 connector




Type E connector

**Sensors with socket**



CS-x, CSE and CSE/Mx models  
with a measuring range from 1 mm

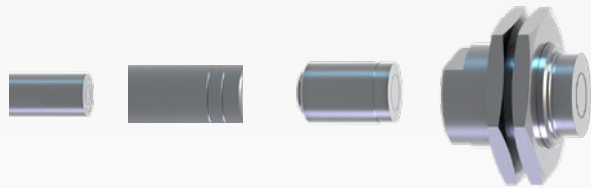


CS, CS-x, CSE and CSE/Mx models  
with measuring range up to 1 mm



CSF flat sensors with socket

**Sensors with integrated cable**

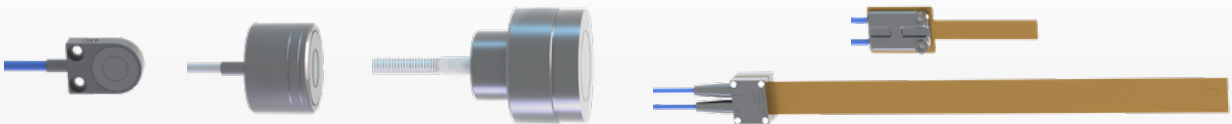


## Vacuum feedthroughs

Micro-Epsilon offers a variety of vacuum feedthroughs for the quick and easy integration of capacitive sensors in high-vacuum and ultra-high-vacuum environments. The feedthroughs are available as screw-in or weld-in versions, or with a large flange. All models are designed for sensors with a type B connector. Feedthroughs for sensors with connector types C and E are available upon request.

### Vacuum feedthrough screwable


Art. no. 0323050

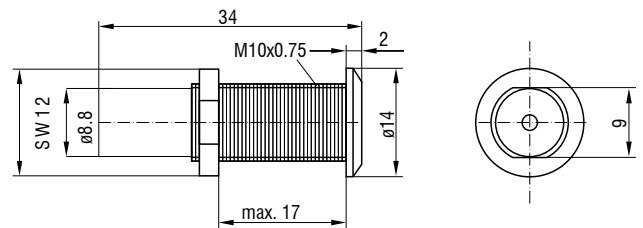

Maximum leak rate:  $1 \times 10^{-7}$  mbar-l-s<sup>-1</sup>, compatible with type B connectors

### Vacuum feedthrough weldable


Art. no. 0323346

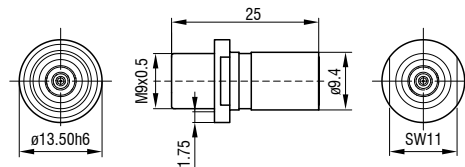

Maximum leak rate:  $1 \times 10^{-9}$  mbar-l-s<sup>-1</sup>, compatible with type B connectors

### Vacuum feedthrough with flange (CF16)

Art. no. 0323349

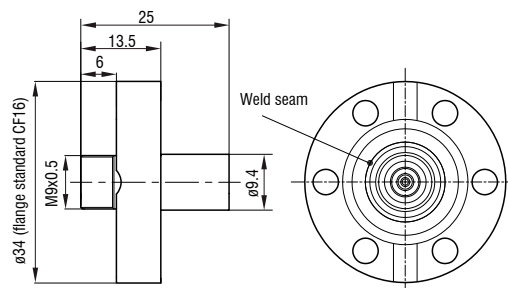



Maximum leak rate:  $1 \times 10^{-9}$  mbar-l-s<sup>-1</sup>, compatible with type B connectors

# Technical details

## capaNCDT

### Minimum diameter of the measuring object

The relative size of the target has effects on the linearity deviation. Ideally, the object being measured should be at least as large as the "Recommended target size" specified in the technical data, or at least as large as the sensor's diameter. In this case, the sensor's full measuring range can be used without the need for additional calibration. Measuring objects smaller than the sensor diameter require a special calibration. The smaller the size (ratio measurement electrode and measuring object), the lower the accuracy.

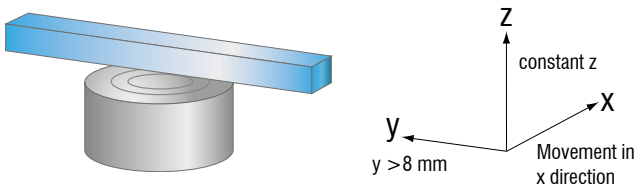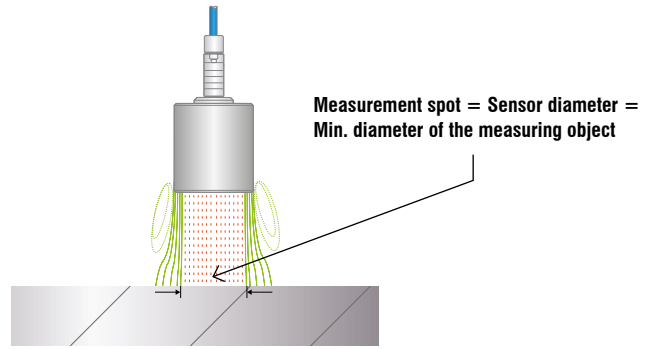


### Measurement on narrow targets

The width of the object being measured affects the capacitive measurement signal. Simulations using a CS05 sensor (8 mm diameter) as an example show that even narrow objects can be measured reliably, provided they are sufficiently large and correctly positioned.

At a distance of 0.25 mm (mid of measuring range), even a centrally positioned object 5 mm wide produces a stable measurement signal. The larger the distance between the sensor and the measuring object, the larger the required minimum width.


The results show that the electric field does not extend beyond the entire diameter of the sensor. This makes it possible to take precise measurements even on narrow objects.

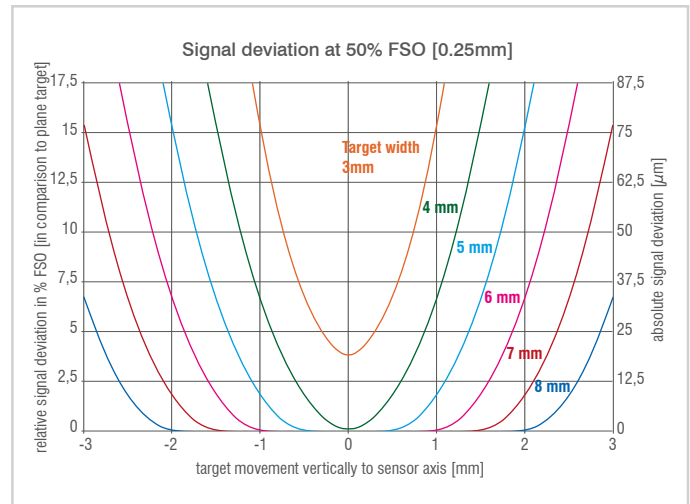

### Conductivity of the measuring object

In order to achieve a linear output signal across the complete measuring range, certain requirements for the target or the counter electrode must be complied with. The impedance in the ideal plate capacitor can be shown in the equivalent circuit diagram by a capacitor and a resistor connected in parallel. For measurement against metals, the ohm part can be disregarded; the impedance is only determined by the capacitive part. Conversely, only the ohm part is considered for measurements against insulators.


In between, there is the large range of semiconductors. Most semiconductors can be measured very well as electrical conductors. The requirement is that the capacitive part of the total impedance is still significantly larger (>10x) than the ohmic part. This is almost always the case for silicon wafers irrespective of the endowment. Nevertheless, semiconductors with poor conductivity (e.g. GaAs) can also be measured as conductors under certain circumstances.

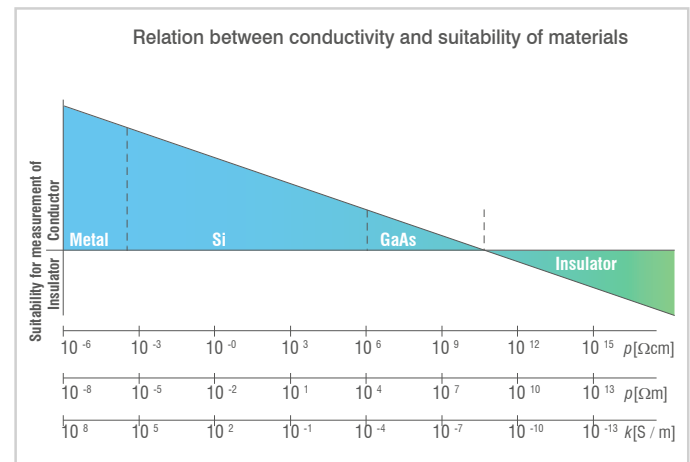

However, various adjustments are required for this, e.g. reduction of the operating frequency or a temporary, partial increase of the conductivity.


### Minimum diameter of round measuring objects:

When measuring distances on curved surfaces such as when measuring wave patterns on rollers, measurement errors may occur. This is caused by the altered field line distribution and an enlarged effective measurement spot, which changes the measured capacitance. In practice, this results in a virtual zero point for the sensor, meaning that the measurement value of  $0 \mu\text{m}$  is no longer

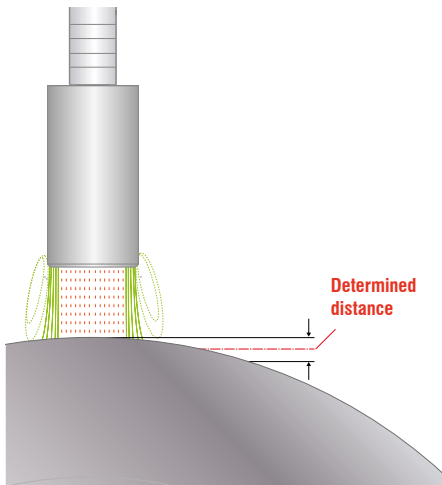

Example: For a sensor with a  $200 \mu\text{m}$  measuring range and a roller with an outer diameter of  $30 \text{ mm}$ , an actual gap of  $20 \mu\text{m}$  results in a measured value that is approximately 5 % higher. This corresponds to approx.  $10 \mu\text{m}$  of the measuring range.



achieved. Since capacitive sensors integrate over their entire measuring surface, the virtual mean measurement plane lies behind the actual generatrix of the cylindrical target object. As this effect is predictable, corresponding correction curves can be stored in the controller.

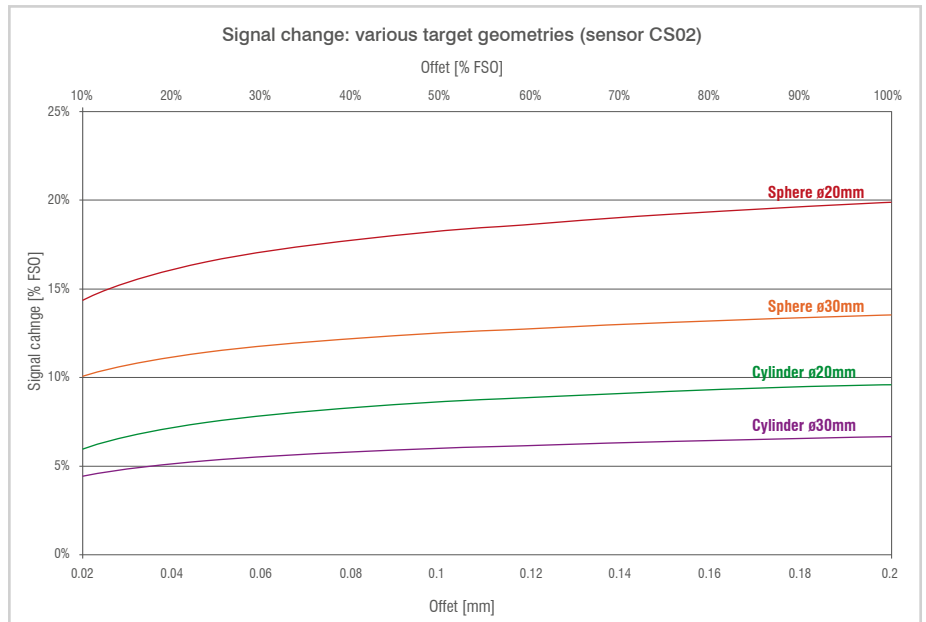

### Inclination:

If the capacitive sensor or the measuring object is tilted, an error is likely to occur, as the geometric conditions of the field relative to the object being measured change. In fact, the average distance of the sensor remains constant; however, the edge areas move closer or further away from the target. The following figure illustrates this effect using the CS02 sensor as an example, with a maximum tilt angle of

$1^\circ$  at various sensor distances. At a 10 % offset along the sensor axis, contact between the sensor housing and the measuring object occurs at  $0.38^\circ$ ; at a 20 % offset, contact occurs at  $0.76^\circ$ . The simulation can be performed for all sensors and installation conditions; tilt angles around a decentralized tilt point can also be calculated.

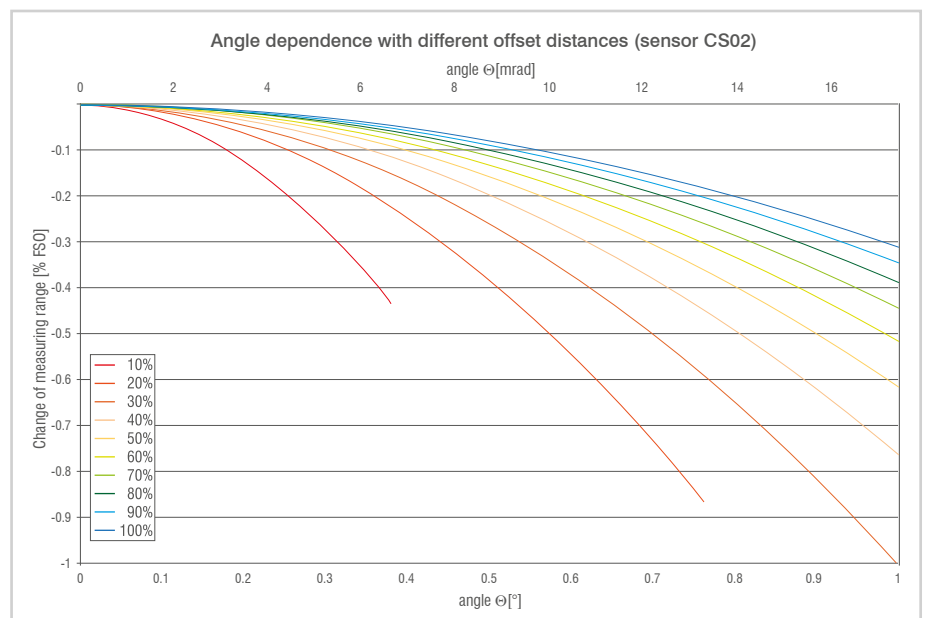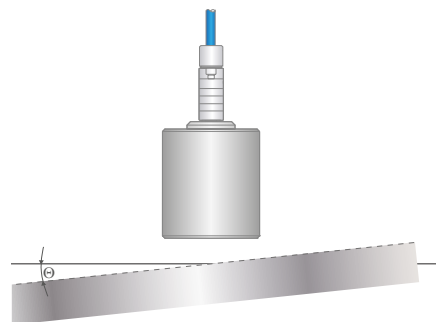


## Sensors and Systems from Micro-Epsilon



Sensors and systems for displacement, distance and position



Sensors and measurement devices for non-contact temperature measurement

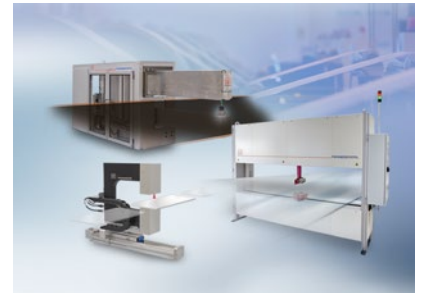


Measuring and inspection systems for metal strips, plastics and rubber



Optical micrometers and fiber optics, measuring and test amplifiers



Color recognition sensors, LED analyzers and inline color spectrometers

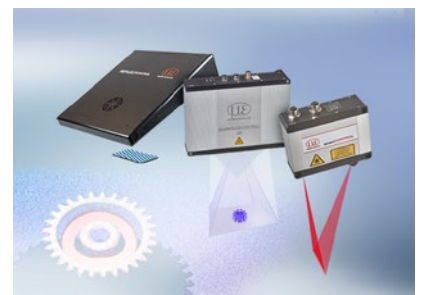

3D measurement technology for dimensional testing and surface inspection